




# Assembly Instruction

IMS CONNECTOR SYSTEMS GmbH  
 Obere Hauptstrasse 30  
 D-79843 Löffingen  
 Postfach 1141  
 D-79840 Löffingen

Tel (+49) 7654 901-0  
 Fax (+49) 7654 901-199  
 Net: www.imscs.com  
 E-mail: sales@imscs.com


<b>Number:</b> M-221	<b>Date:</b> 22.08.2006
<b>Description:</b> Cable mount plug	<b>Signature:</b> U. Mayer
	<b>Page:</b> 1 of 1

Using parts:

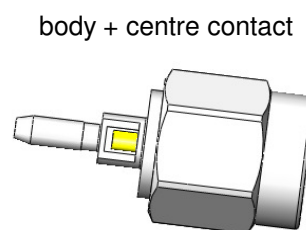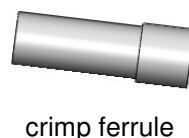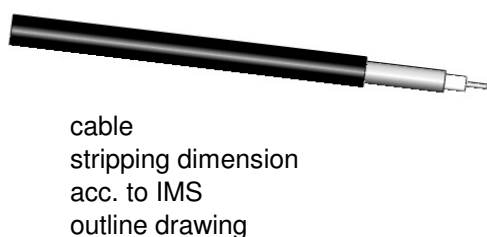

Exemplified with SMA connector

 
1.) Slide the crimp ferrule and the heatshrink tubing (opt.) onto the cable.




2.) Fan the braid and slide the cable into the body and centre contact.

3.) Crimp the centre contact.

Crimp tool: IMS P/N: AGK-2990

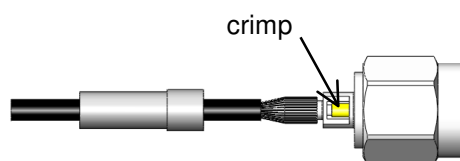


 4.) Slide the crimp ferrule over the braid.



5.) Crimp the crimp ferrule.

Crimp hex: 2,67 mm  
 Crimp length: 4,0 mm

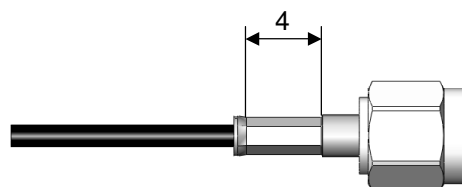

6.) Slide the optional heatshrink tubing over the crimp ferrule and heatshrink it in place.